

# BRINKLEY

## CSC-2302 Interior Soffit Repair

CSC-2302

**Notification Date 2-8-23**

### **Issue:**

BRV has issued a Customer Satisfaction Campaign (CSC-2302) regarding the island soffit panel. The affected units in the vin range could have a loose securement allowing the panel to sag.

### **Action:**

Step 1 –

Drop the island lighting panel and box to gain access to the framing above (Pics attached). At that point locate the rafter area within the framing and add additional 2 ½” fasteners to the framing where applicable.

Step 2 –

Separate the lighting panel from the soffit box and add a 1/8” bead of Sikaflex or Trem Pro Chem X adhesive between the panel and soffit then reattach. Clearing any oozing before resecuring to the ceiling.

**Labor Allowance: 1 hour**

**Flat Rate Code: CSC-2302**

### **Parts Needed:**

4-6 2 ½” wood screws

1 tube of Seka Flex or Chem X adhesive

